ARTE CONTRACT

Luxurious 54" vinyl wallcoverings for the contract market

Data Sheet

SILKX RAW

References

_	67490 - 67502			
	07470 - 07302		U.S. UNITS	METRIC UNITS
	TOTAL WEIGHT:		+/- 20 oz PLY	+/- 630 gr/lm
			+/- 13.3 oz PSY	+/- 460 gr/m ²
	ROLL WIDTH:		52/54 in.	132/137 cm
	FABRIC:		Woven	
	REPEAT:	horizontal	N.A.	N.A.
		vertical	N.A.	N.A.
	NOMINAL PATTERN WIDTH:		51 in.	130 cm
	HANGING INSTRUCTIONS:		Non-reverse - Random match	
	TENSILE (minimum):		50 x 55 lbf	222 x 245 N
	TEAR (minimum):		25 x 25 lbf	111 x 111 N
	ASTM F-793:		Category V type II	
	WA Spec:		W 101 - 2011 type II	




Specially for the contract market, Arte combines design, colour and quality in a magisteral way.

The luxurious but extremely durable vinyl wallcovering meets the most stringent

technical requirements for this highly demanding market, such as fire resistance, shock resistance and washability.

This is why Arte's contract wallcovering is so widely used in hotels, offices and elderly and nursing homes.

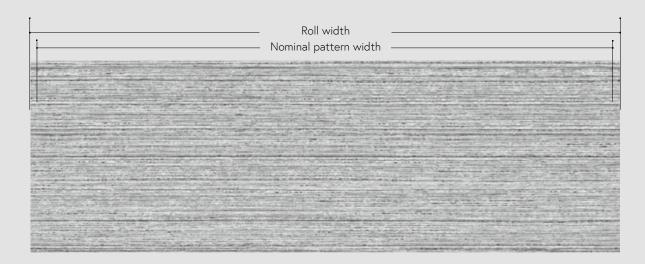

Notes:

- "Roll width" represents the width of the wallcovering that will be received by the customer.
- "Nominal pattern width" is the expected width yield from one drop on the wall.
- "Tensile" and "Tear" results are the minimums required by CCC-W-408A federal specifications.



References





















FIRE TESTING:

US CLASSIFICATION

NFPA 101° Life Safety Code°

ASTM E-84 Tunnel Test¹

- Class A Rating

NFPA 286 Corner Burn Test²

- Meets requirements for Flame Spread, Smoke

Developed and Flashover

1. When tested on GRC board with A-848-B adhesive 2. When tested on 5/8" type X gypsum board with A-848-B adhesive

EU CLASSIFICATION

in accordance with EN 15102:2007 + A1:2011

Fire Behavior Smoke Production s2

Flame Droplets

0493/22



IMO certificate available for quantities from 300 linear metres/328 linear yards.

SILKX RAW 67495 - 67496 - 67500

These decorative metallic wallcoverings should only be cleaned with mild ingredients such as soap, detergent and water. Stronger, more alkaline household cleaners and/or excessive scrubbing, have the potential to damage the surface of the wallcovering.

