
ARTE CONTRACT

Luxurious 54" vinyl wallcoverings for the contract market

Data Sheet AURORA

References

67160 - 67171			
0/100 - 0/1/1		U.S. UNITS	METRIC UNITS
TOTAL WEIGHT:		+/- 20 oz PLY	+/- 630 gr/lm
		+/- 13.3 oz PSY	+/- 460 gr/m ²
ROLL WIDTH:		52/54 in.	132/137 cm
FABRIC:		Woven	
REPEAT:	horizontal	26 in.	66 cm
	vertical	38.6 in.	98 cm
NOMINAL PATTERN WIDTH:		52 in.	132 cm
HANGING INSTRUCTIONS:		Straight match	
TENSILE (minimum):		50 x 55 lbf	222 x 245 N
TEAR (minimum):		25 x 25 lbf	111 x 111 N
ASTM F-793:		Category V type II	
WA Spec:		W 101 - 2011 type II	

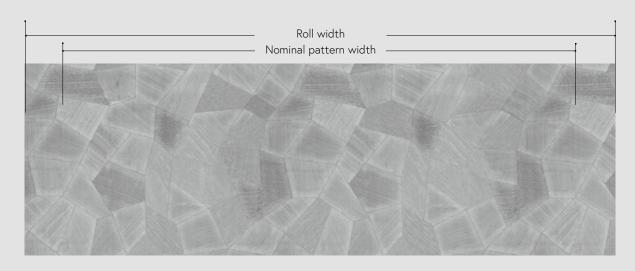

Notes:

- "Roll width" represents the width of the wallcovering that will be received by the customer.
 "Nominal pattern width" is the expected width yield from one drop on the wall.
- "Tensile" and "Tear" results are the minimums required by CCC-W-408A federal specifications.



Specially for the contract market, Arte combines design, colour and quality in a magisteral way.

The luxurious but extremely durable vinyl wallcovering meets the most stringent

technical requirements for this highly demanding market, such as fire resistance, shock resistance and washability.

This is why Arte's contract wallcovering is so widely used in hotels, offices and elderly and nursing homes.





AURORA

















FIRE TESTING:

US CLASSIFICATION

NFPA 101° Life Safety Code°

ASTM E-84 Tunnel Test¹

- Class A Rating

NFPA 286 Corner Burn Test²

- Meets requirements for Flame Spread, Smoke

Developed and Flashover

1. When tested on GRC board with A-848-B adhesive 2. When tested on 5/8" type X gypsum board with A-848-B adhesive

EU CLASSIFICATION

in accordance with EN 15102:2007 + A1:2011

Fire Behavior Smoke Production s2

Flame Droplets



IMO certificate available for quantities from 300 linear metres/328 linear yards.

0493/22

AURORA 67163 - 67164 - 67166 - 67167 - 67168 - 67169 - 67170

These decorative metallic wallcoverings should only be cleaned with mild ingredients such as soap, detergent and water. Stronger, more alkaline household cleaners and/or excessive scrubbing, have the potential to damage the surface of the wallcovering.

-ARTE